

LEADER Mount

Universal projector mount:

- Direct
- Adjusted 48 – 74
- Adjusted 66 – 110
- Adjusted 120 - 200




LIST OF ITEMS:

- Projector mount:
- Universal projector adapter
- Adjusted arm (mount with arm)
- Mounting set
- Installation manual
- Mounting template

1. Installation:


A. Prepare an installation place and mark mounting points using installation template as below:

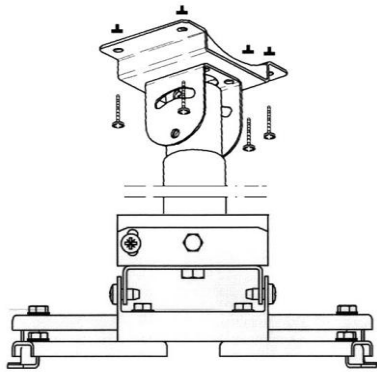


Install mount to the ceiling

B. Install projector on universal projector adapter. Use mounting screws from mounting set.

Warning! To connect the mount with the projector, select the appropriate screws from the mounting kit according to the recommendations of the projector manufacturer.

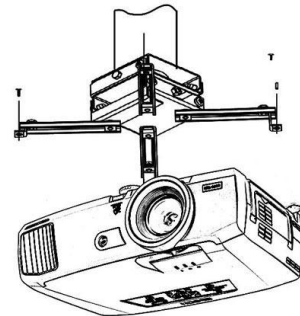


C. Joint adapter with installed projector with projector mount as described below using middle hanger. Block projector on a mount with screws in holes A.

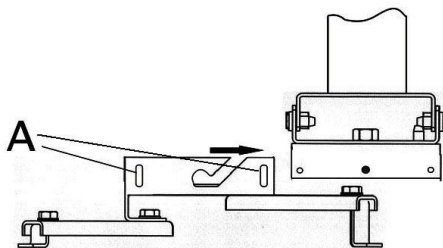

D. Check and adjust proper projected image. If needed adjust projector image on a ceiling mount.


2. Adjusting projector on a ceiling mount:

A. Adjusting height of installed projector: Loosen screw B and adjust expected height of projector. Tighten screw B. In Direct Mount height is non-adjustable

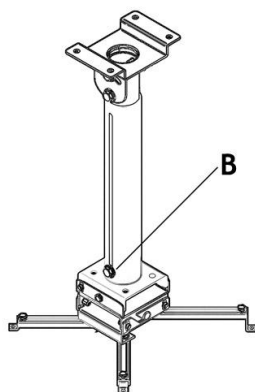


B. Pitch axis adjustment.

If projected image is too low or high on the screen/vertical distortion/, Loosen screws C and tilt projector to expected vertical position. Tighten screws C, when finished

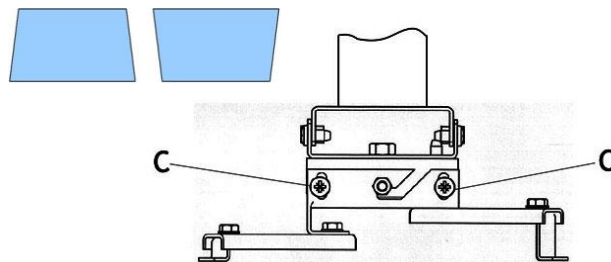


C. Yaw axis adjustment.

If projected image is to the right or left on the screen/horizontal distortion/, rotate projector on a screw D.

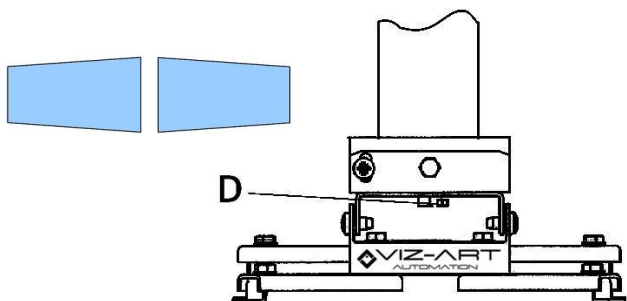

D. Roll axis adjustment.

Loosen screws E, then adjust the projector mount's roll adjustment such that the top and bottom edges of the image are approximately horizontal and aligned with the top and bottom of the screen. Tighten screws E, when finished.

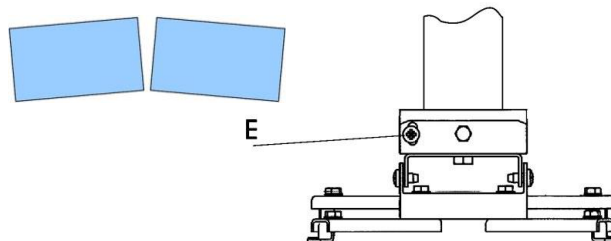

3. Technical Specification:

Product model:

LEADER Mount

Adjustment:

górn-dół 15 stopni
prawn-lewn 15 stopni
Poziom 18 stopni
Pochylenie 56 stopni (z wys.)

Weight:

LEADER Mount bezpósrzedni 1,1 kg
LEADER Mount 48 -74 z wys. 3 kg
LEADER Mount 66-110 z wys. 4 kg
LEADER Mount 120-200 z wys. 6,5 kg

4. Mounting kit set :

Śrubv:

M4x12 – 4 szt.;
M5x12 – 8 szt.;
M6x12 – 4 szt.;

Podkładki:

ø6x12 – 8 szt.;
ø5x10 – 4 szt.;

Kółki rozporowe:

ø8x40 – 4 szt.

Wkręty:

ø5x40 z płaskim łbem – 4 szt.

manufactured: VIZ-ART Automation

tel.+48 22/6138899 www.viz-art.pl